




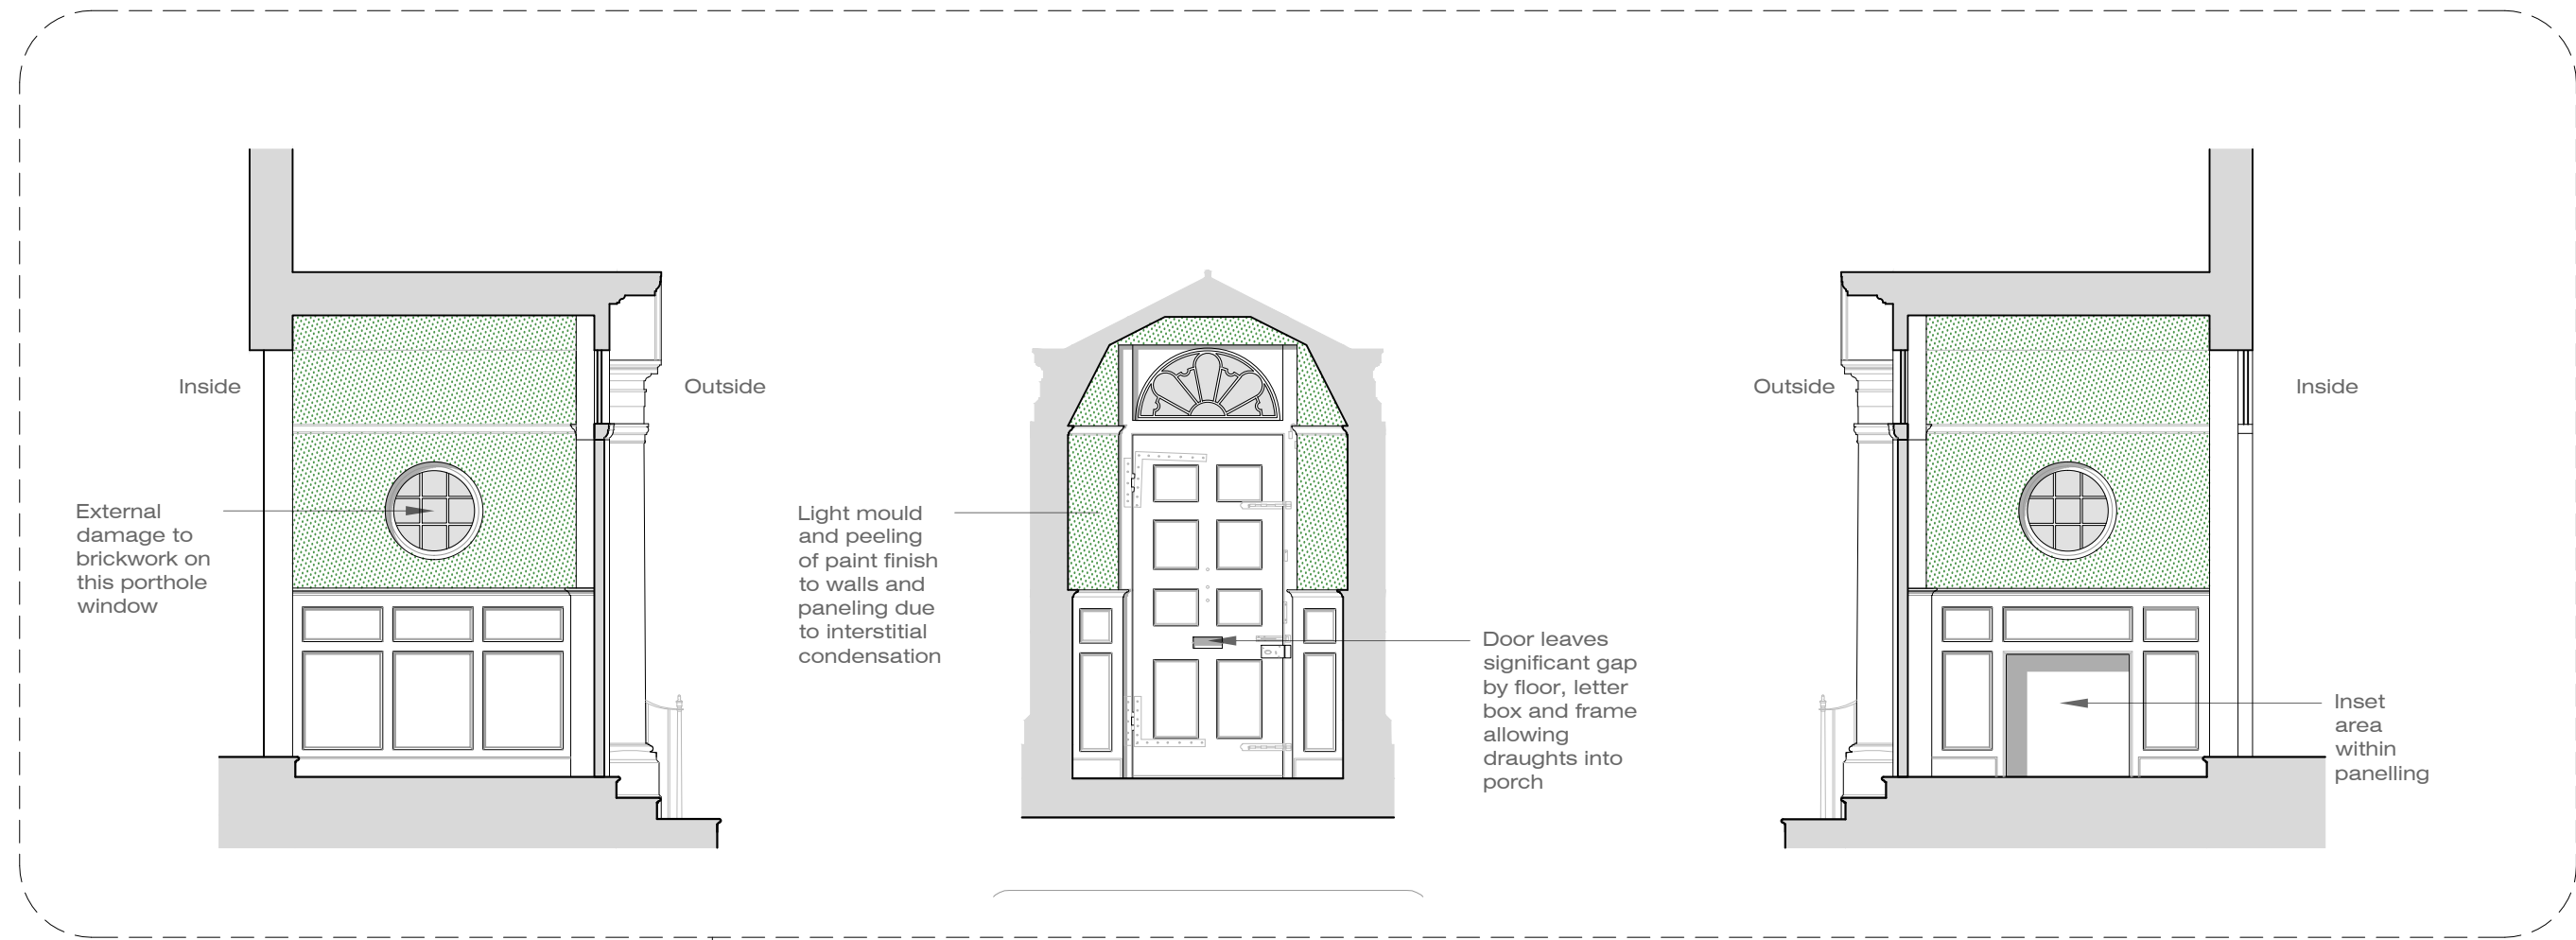

Internal elevations of front porch @ 1:50

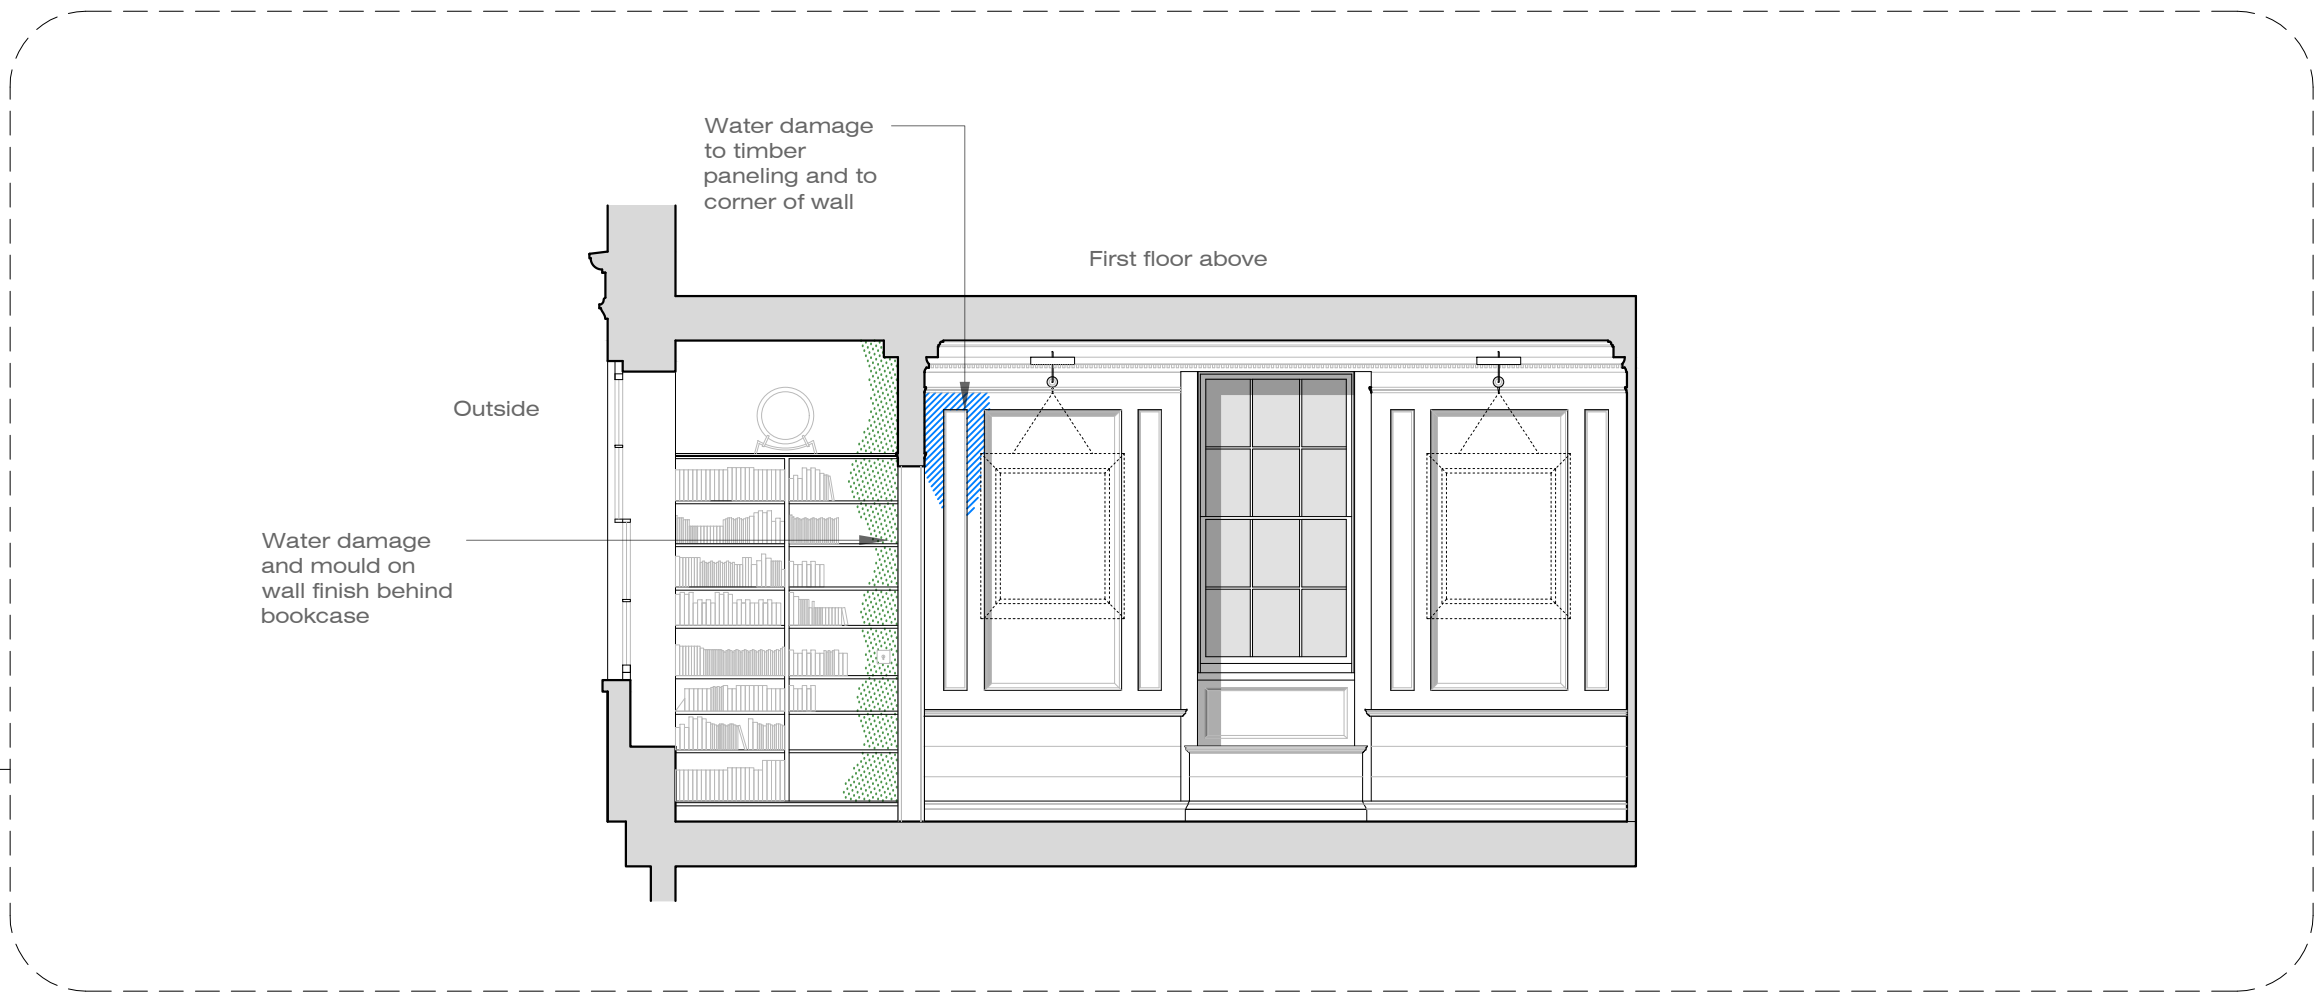

Internal elevation of dining room @ 1:50

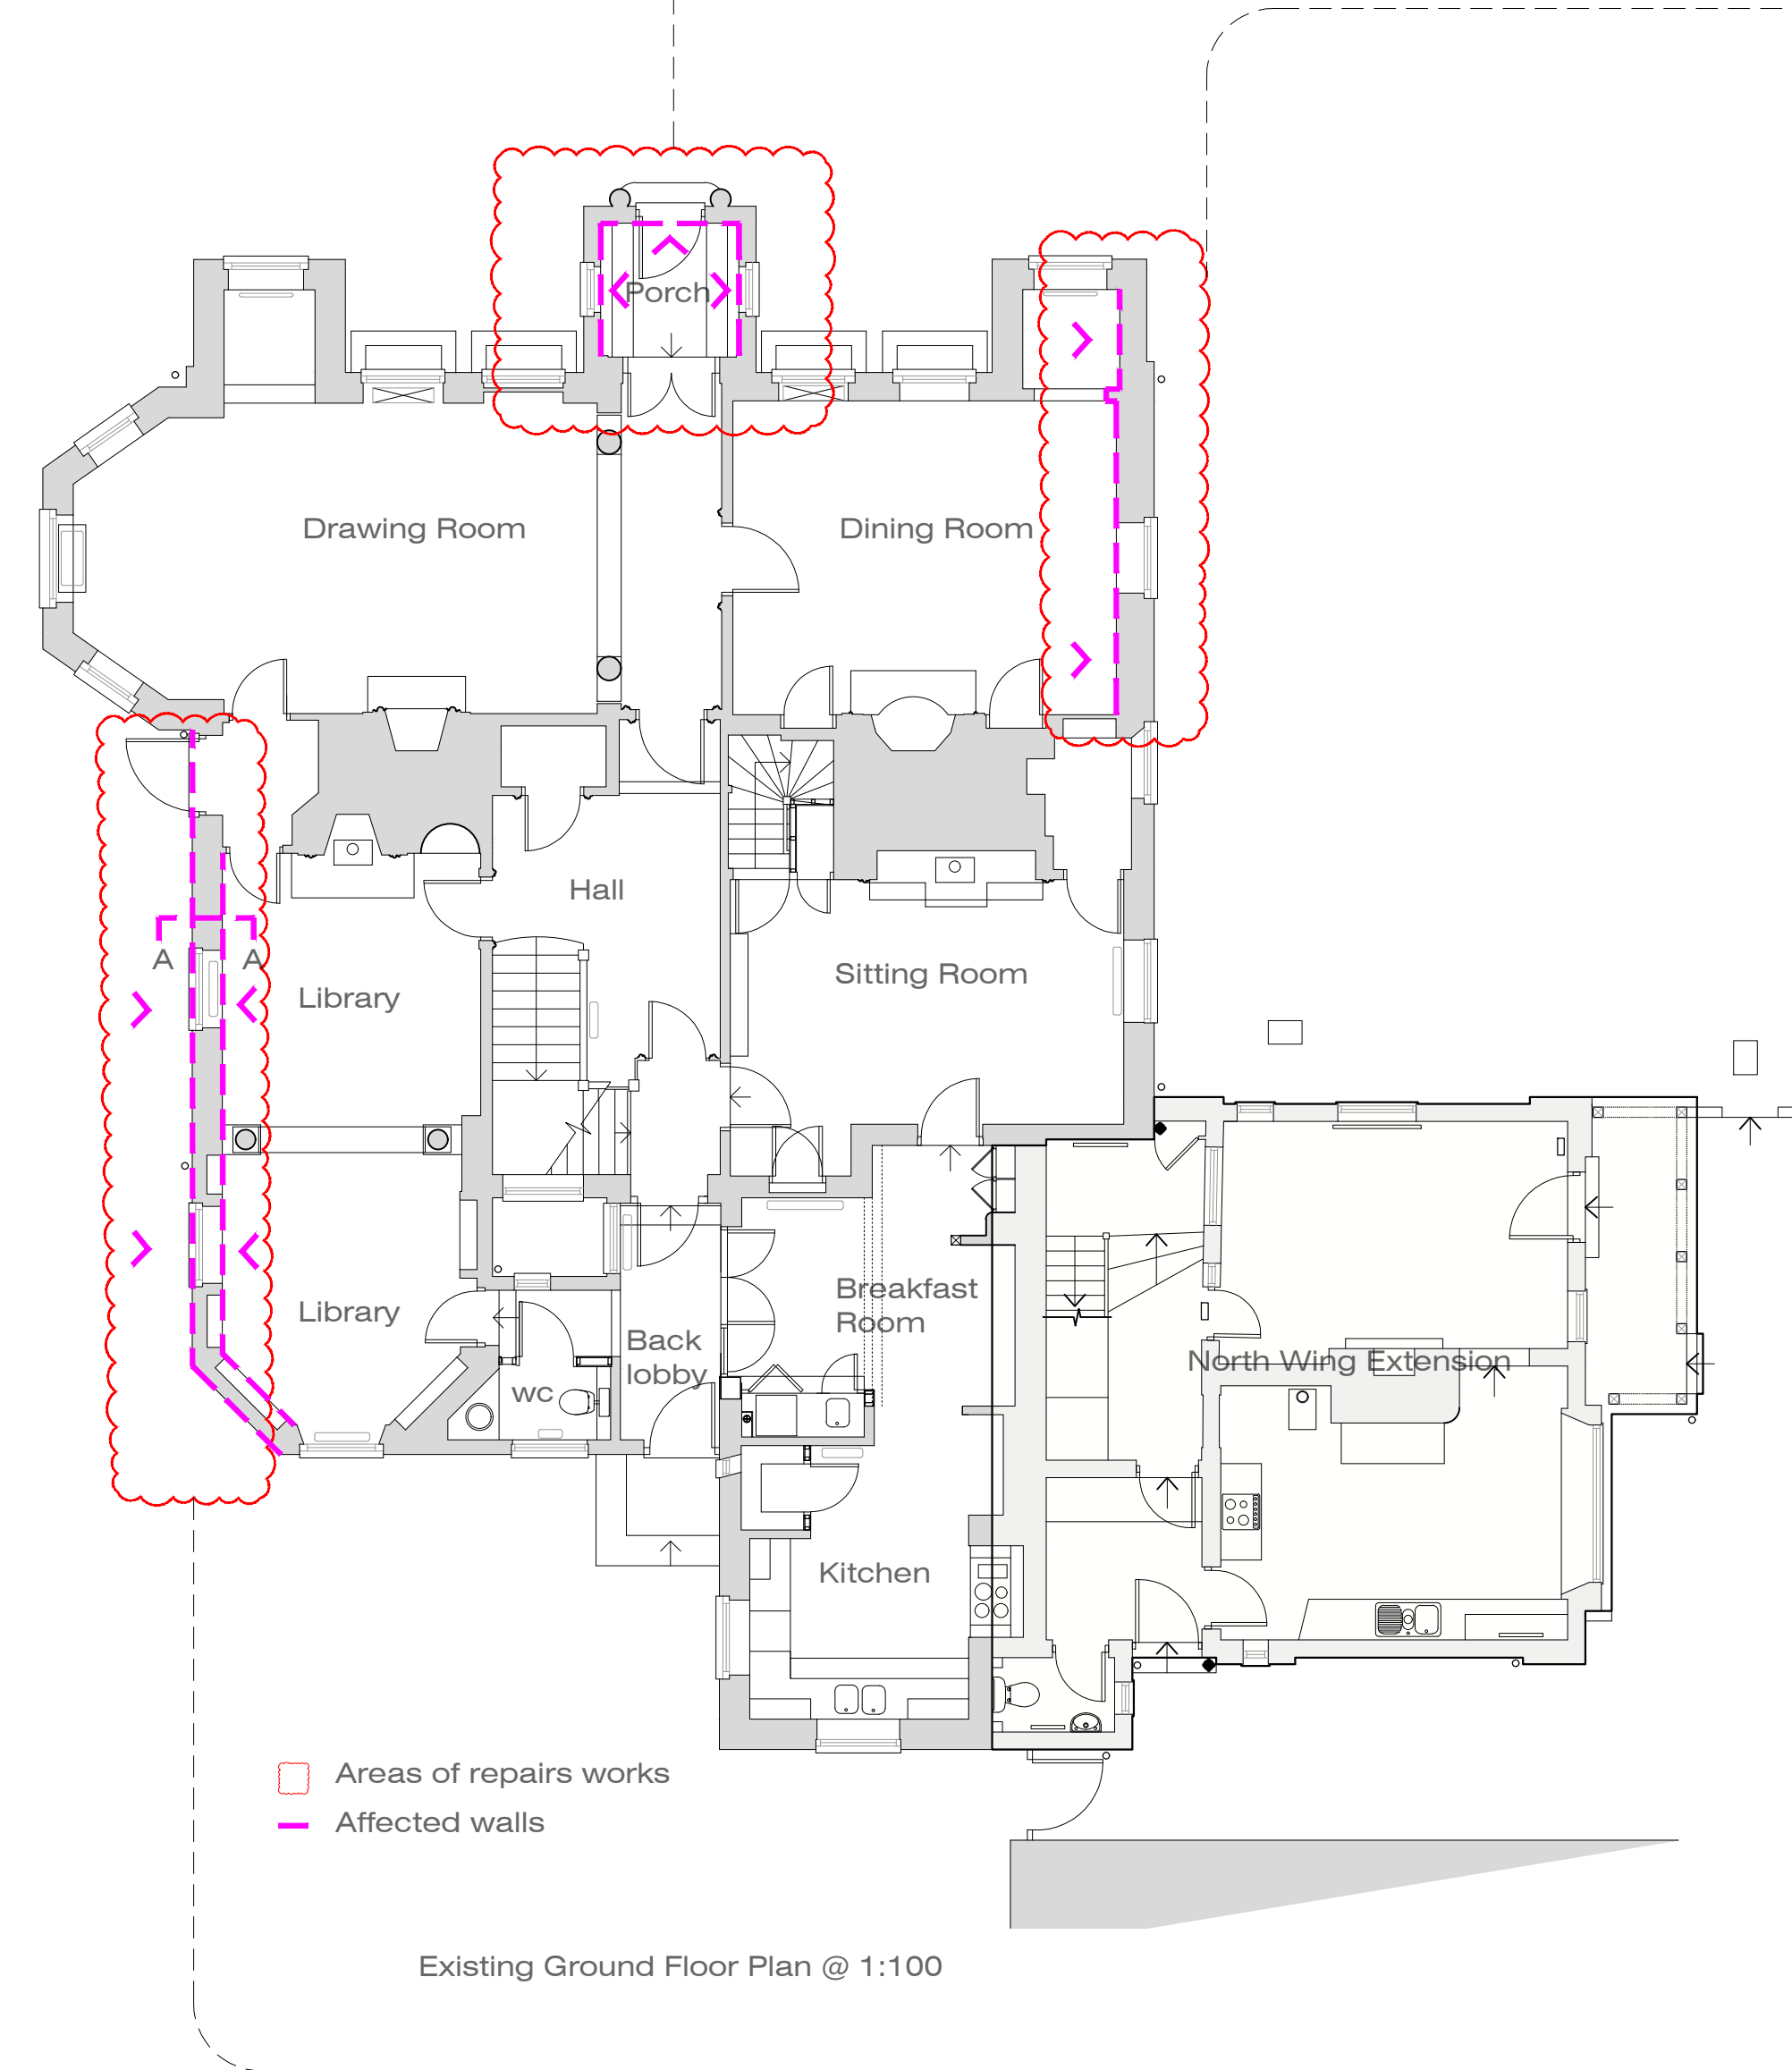


□ Areas of repairs works
— Affected walls


Existing Ground Floor Plan @ 1:100

- Defects Drawing Key:
- Spalling Brickwork
 - Improper Mortar Repairs
 - Mould
 - Water Damage
 - Water ingress

Please note 'HS' refers to Heritage Statement - all drawings to be referenced alongside HS document for full description of defects and repairs. All works to be undertaken in line with conservation principles and techniques.

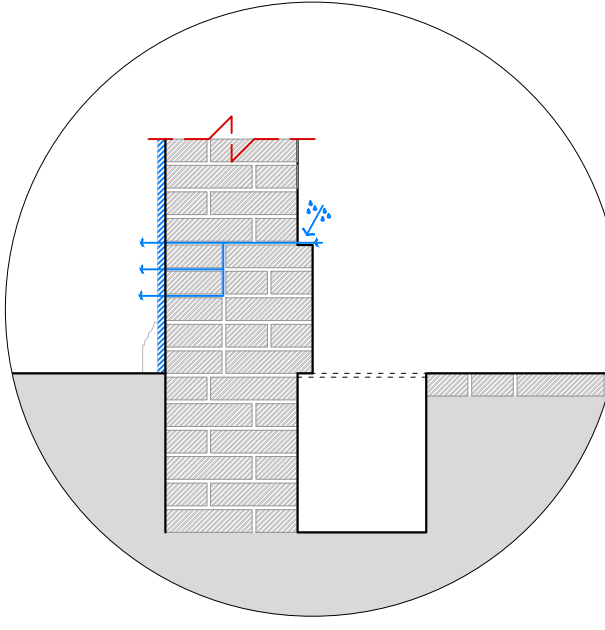

Plinth section AA @ 1:20 showing flat head plinth causing water ingress problems. Area catches debris, vegetation and holds water.

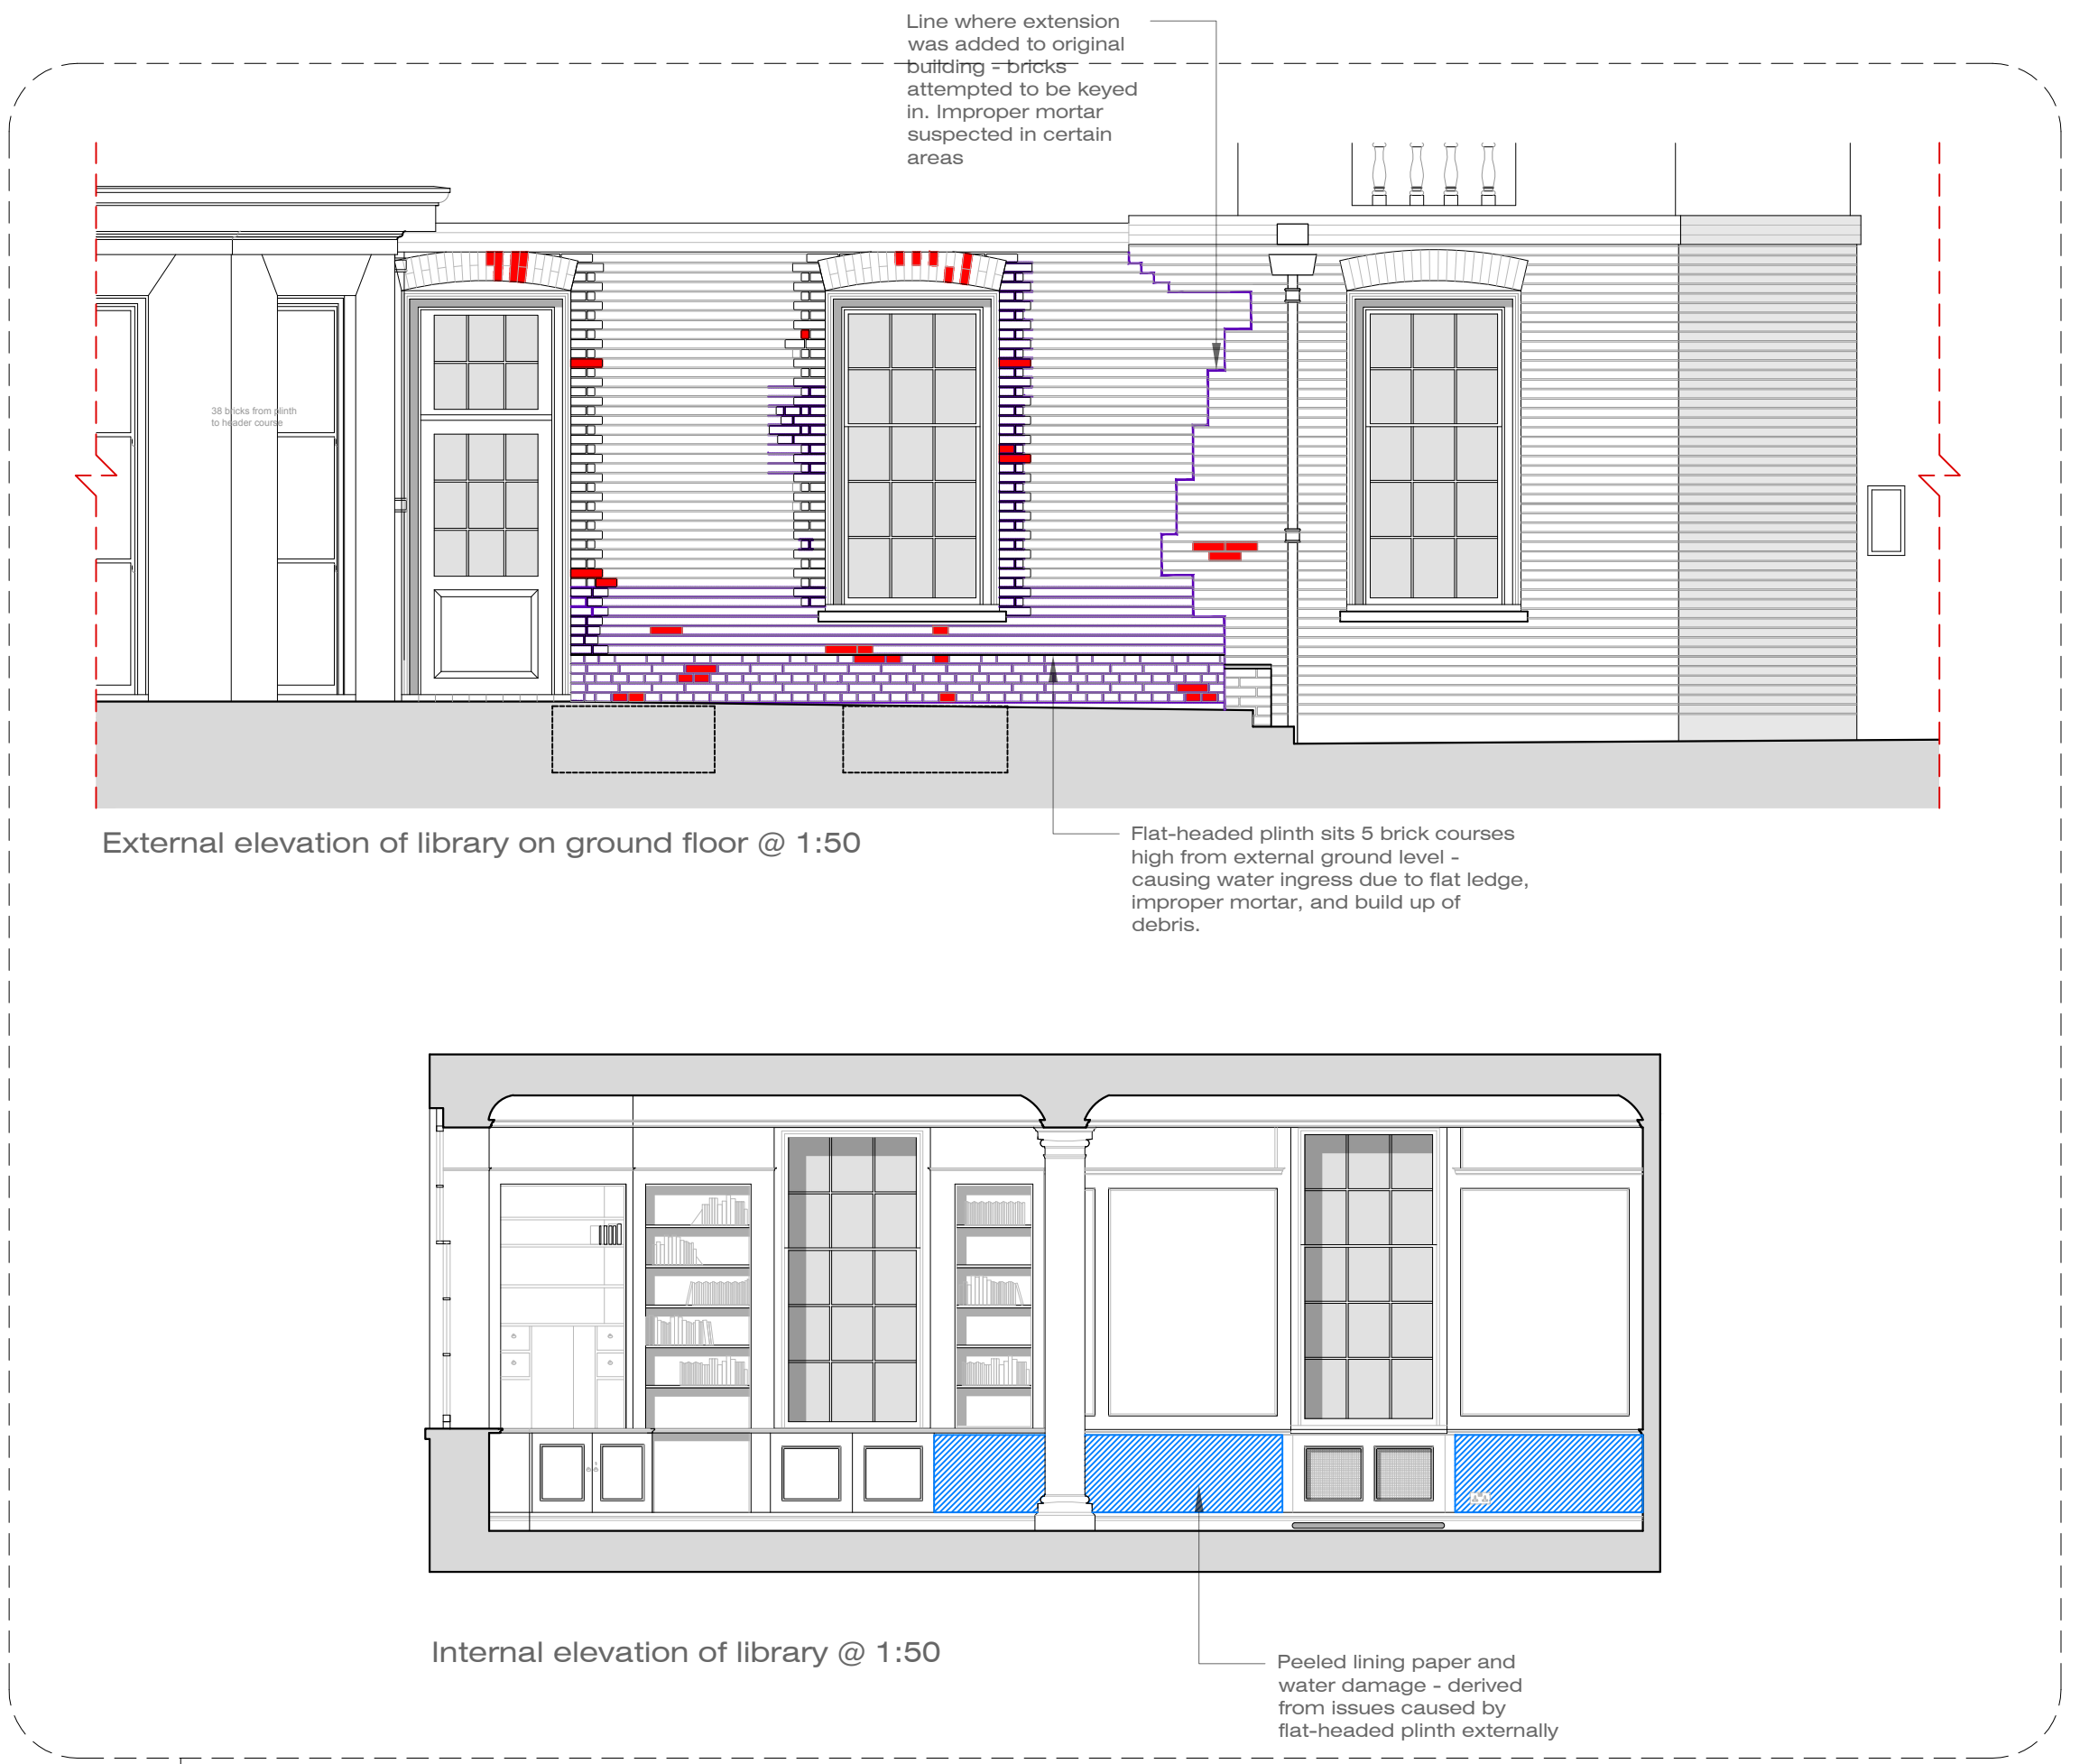

External elevation of library on ground floor @ 1:50

Internal elevation of library @ 1:50

