

View of existing parapet wall taken from Crutches Lane – several bricks have little or no mortar, the parapet wall has very recently pulled away from the main building (moving to the right on this photo) and a section of brickwork on the left-hand side of the buttress is in imminent danger of collapse



View of parapet wall
on the school side
(below) and where it
joins the main
building (upper
photo)
Note different bricks
with harder bricks
upper and brick
'rubbers' lower. Note
how many of the
rubbers have blown
faces with more than
half of the depth of the
bricks missing in
several locations





Close ups of parapet wall from school side, it is possible to see daylight straight through this wall in several locations





Note very poor coping detail – mortar benching



Brick coping detail in cementitious mortar has failed – bricks have lifted and weeds are growing out of the failed brick joints

