

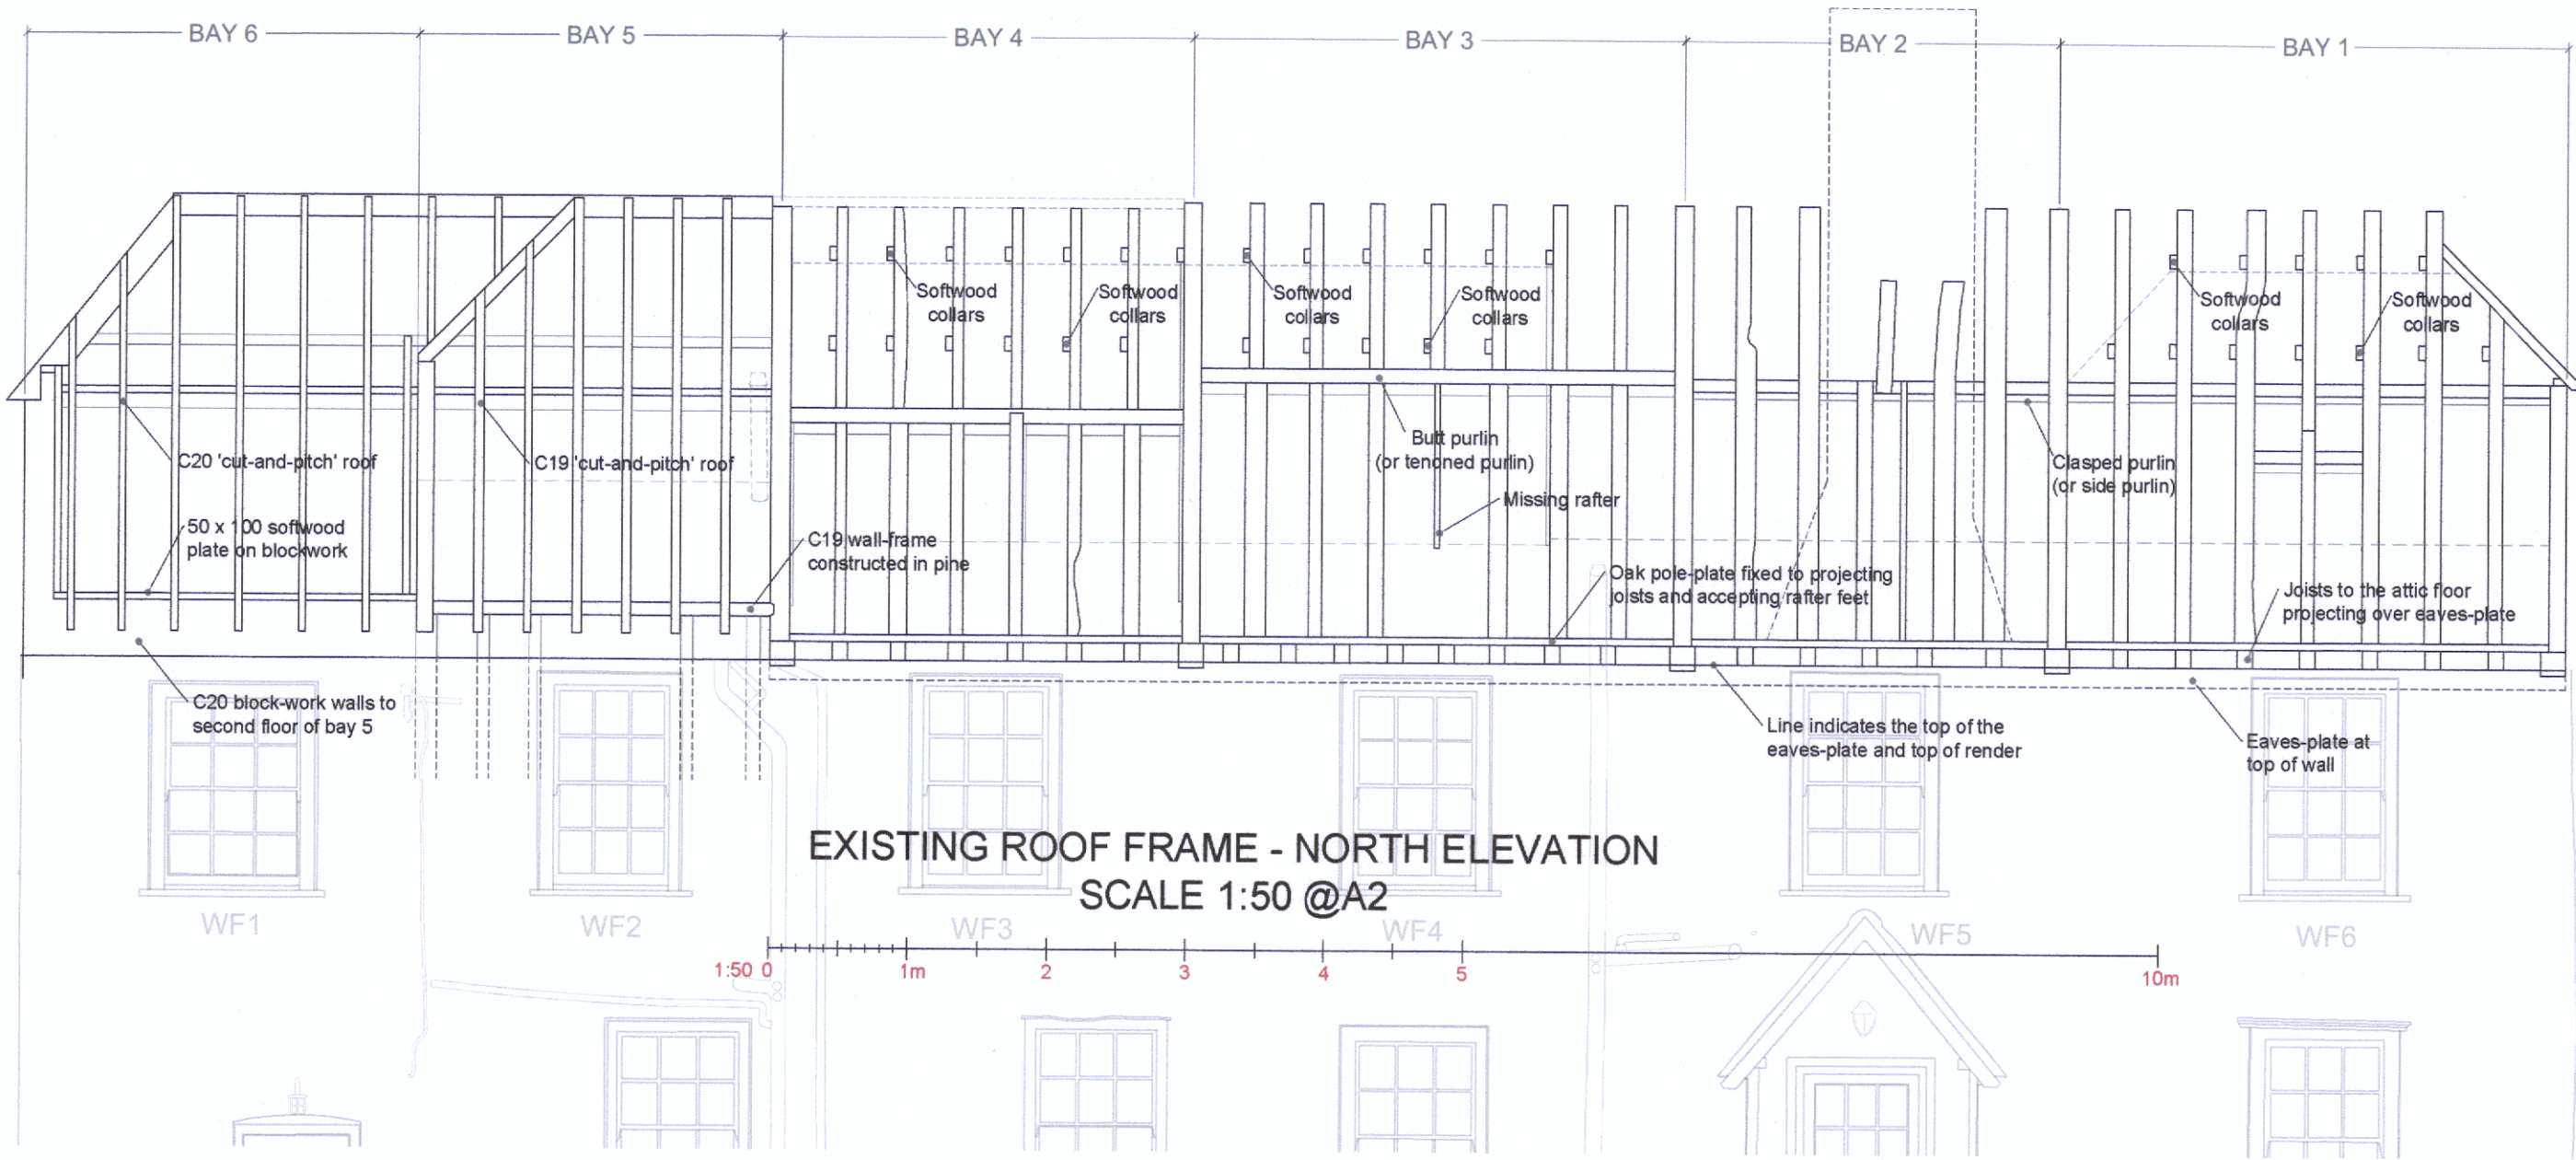
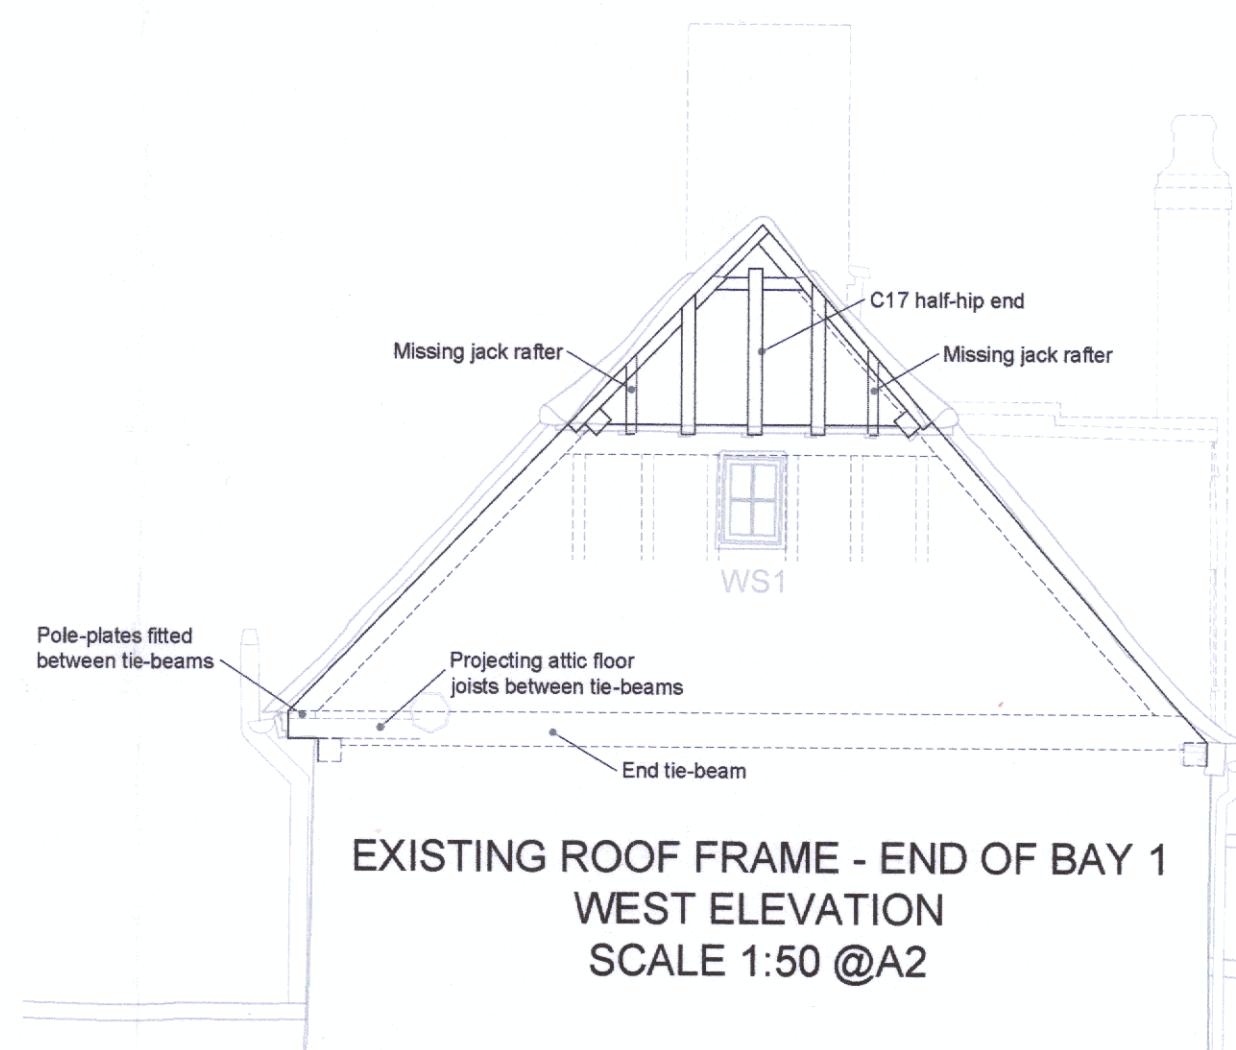


NOTE!! Existing furring strips to roof have been stripped of to assess the extent of repairs

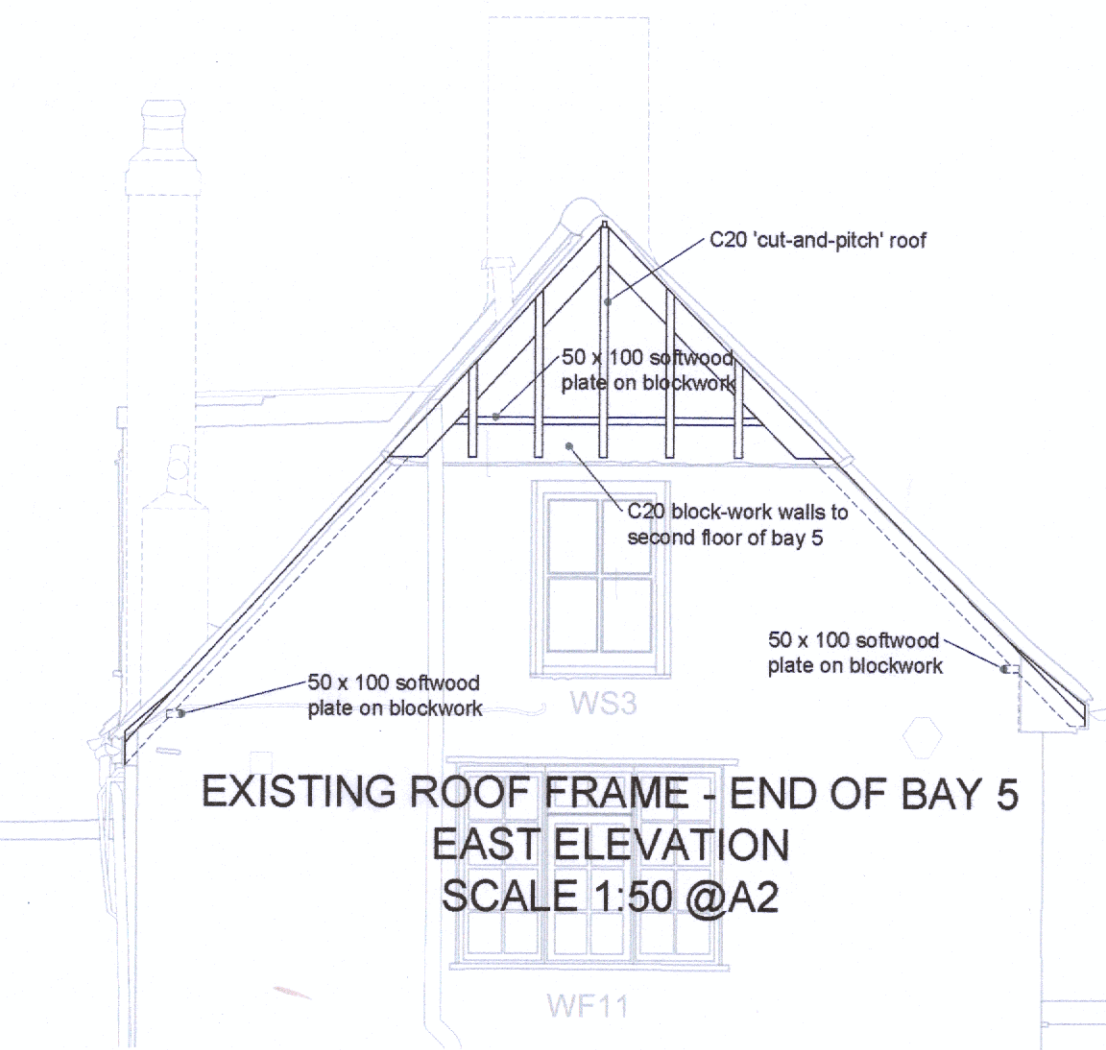

NOTE!! Existing furring strips to roof have been stripped of to assess the extent of repairs

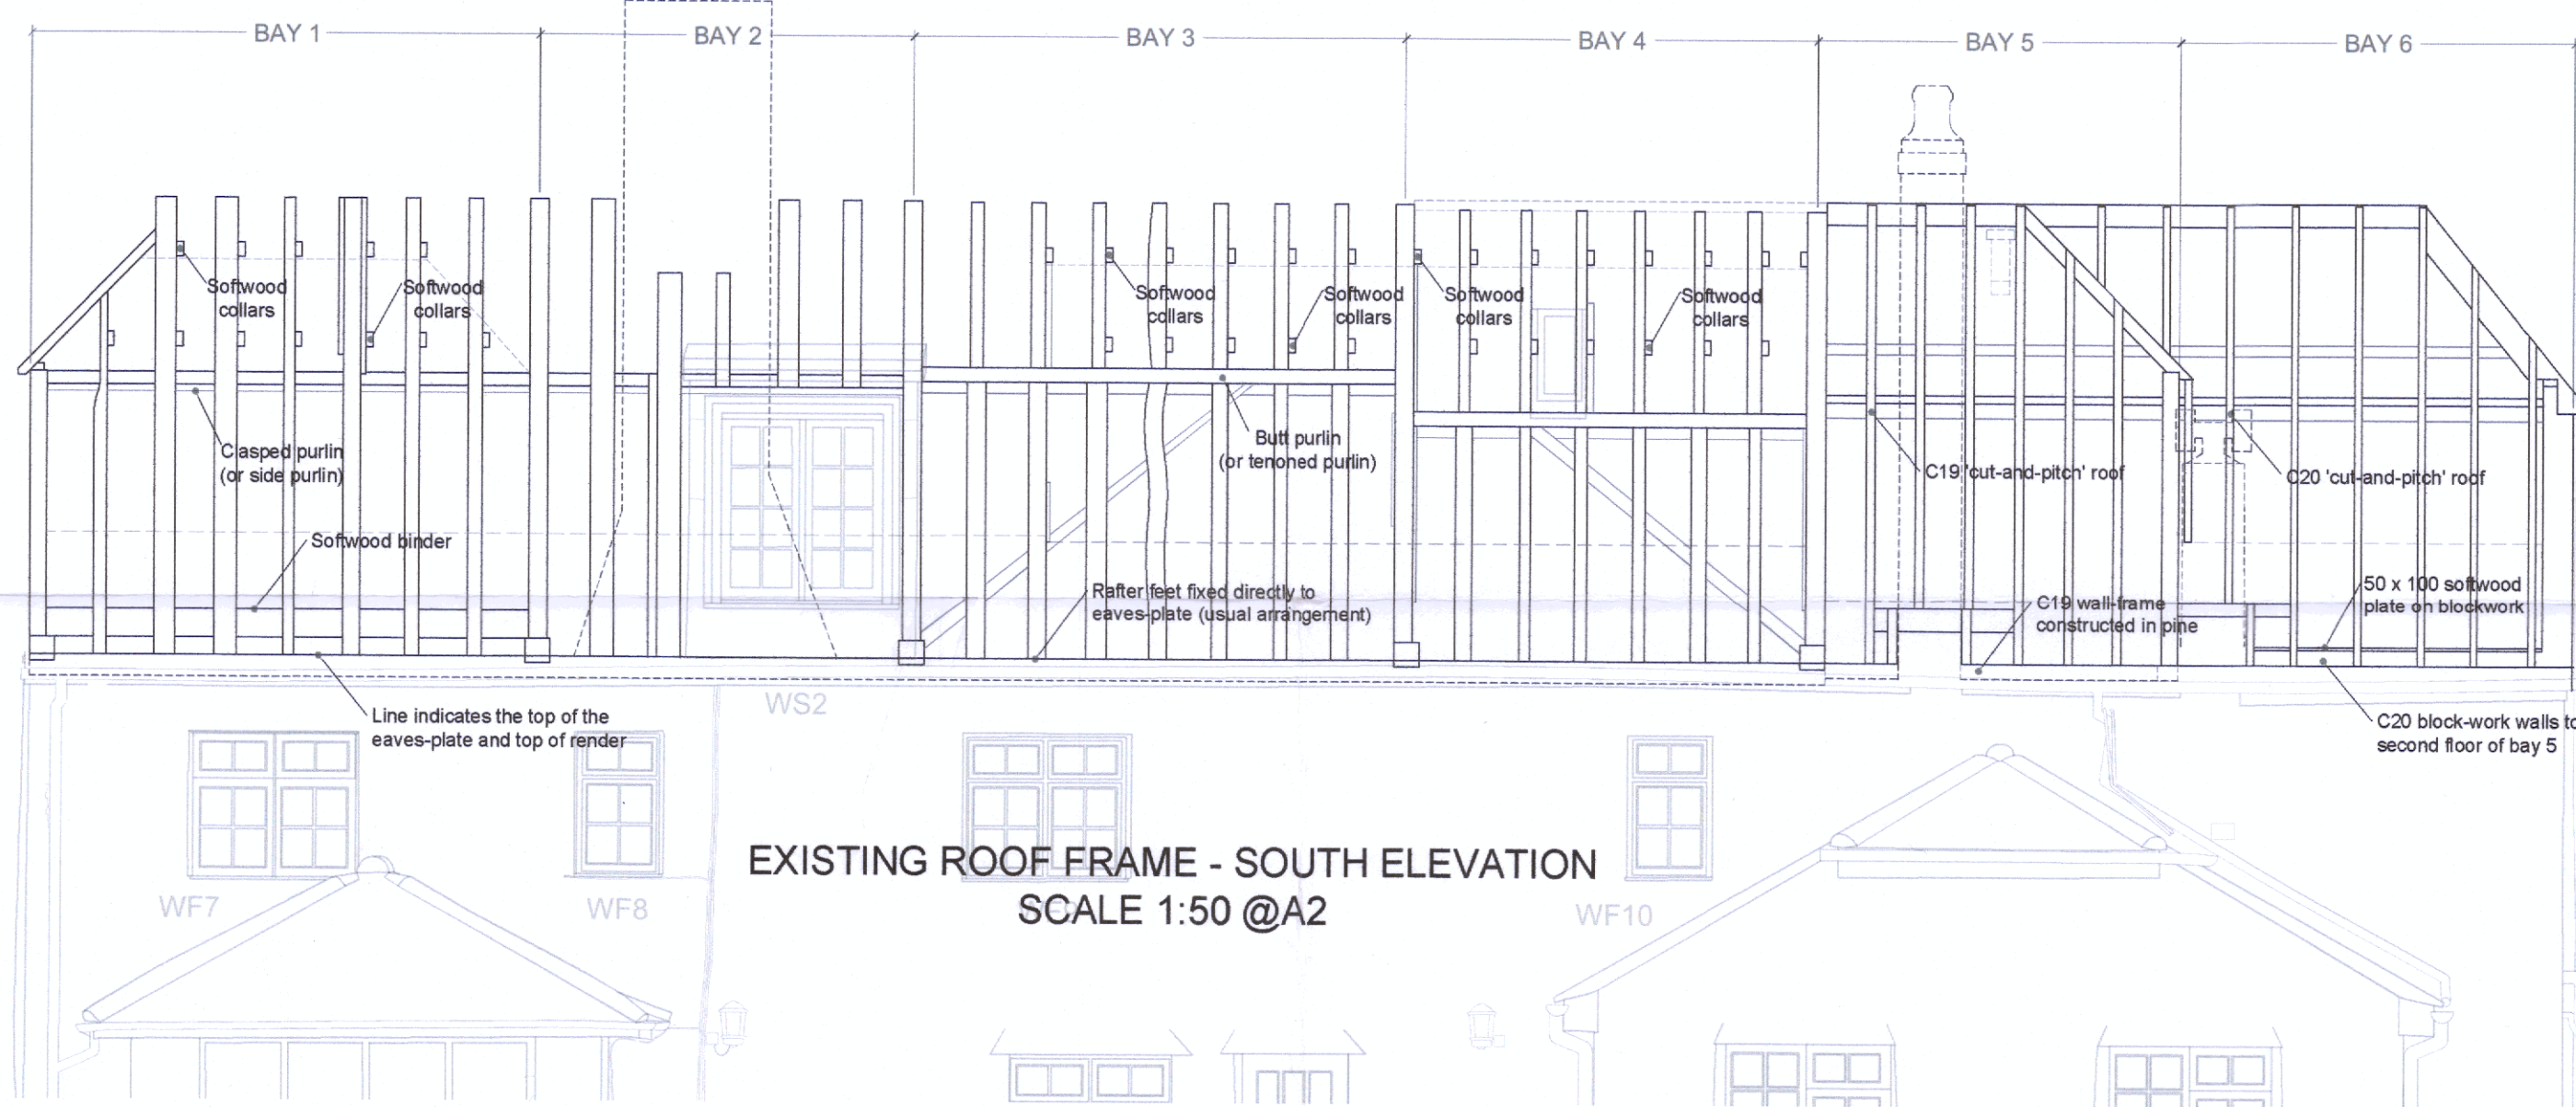

SCALE FOR PLANNING PURPOSES ONLY. ALL DIMENSIONS AND LEVELS SHOWN ARE TO BE CHECKED ON SITE PRIOR TO COMMENCEMENT OF WORK. THIS DRAWING SHOULD NOT BE USED OTHER THAN FOR ITS INTENDED PURPOSE.

NOTES: PLANNING DRAWINGS

BAYS 1 & 2 -- Clapsed purlin roof, no traditional wind-braces. No trimmers at axial chimney. A high proportion of rafters have been re-used from an older crown post roof. Unusual arrangement of a pole-plate for the rafter feet to the north and the common arrangement of rafter feet fitted directly to eaves-beam to the south. Rafters taper towards the ridge and are bridle-jointed with no ridge board. Softwood collars have been fitted above the purlin and close to the ridge in places. Half-hipped end with gablet.

BAYS 3 & 4 -- Staggered butt purlin roof tenoned into principal rafters. Unusual arrangement of a pole-plate for the rafter feet to the north and the common arrangement of rafter feet fitted directly to eaves-beam to the south. A number of rafters have been re-used from older roof(s). Rafters are bridle-jointed at the ridge with no ridge board. Softwood collars have been fitted above the purlin and close to the ridge in places.

BAY 5 -- Clapsed purlin roof, purlin fitted perpendicular to rafters. Roof and wall frame added to bay 4 in C19, constructed in Pine. Level eaves at this bay when it was formerly the end wall after extending. Previous half-hip still evident.

Bay 6 -- Clapsed purlin roof, purlin fitted perpendicular to rafters. Added to bay 5 in mid-late C20. Softwood cut-and-pitched roof with half hip...no gablet.

DESCRIPTION	
EXISTING ROOF FRAMEWORK ELEVATIONS	
LOCATION	DRG No.
NURSTEAD HALL	PP-18Q-0006
NURSTEAD LANE	REV
LONGFIELD HILL	SCALE
KENT, DA3 7AN	1:50 @ A2
CLIENT	DATE
MR & MRS HOLM	NOVEMBER 2023
	SIG
	RP

COPYRIGHT

This drawing has been compiled by and is the sole property of Anthony Hicks Ltd and as such cannot be copied, duplicated, reproduced or its contents used in any way, without prior written authority

Anthony Hicks
TRADITIONAL OAK BUILDINGS

JESSAMINE FARM, OLD ROMNEY, KENT TN29 9SG
Tel: 01797 366895 Fax: 01797 361895
www.anthony-hicks.com