


TO BE READ IN CONJUNCTION WITH PHOTOGRAGHIC REPORT AND SPECIFICATION

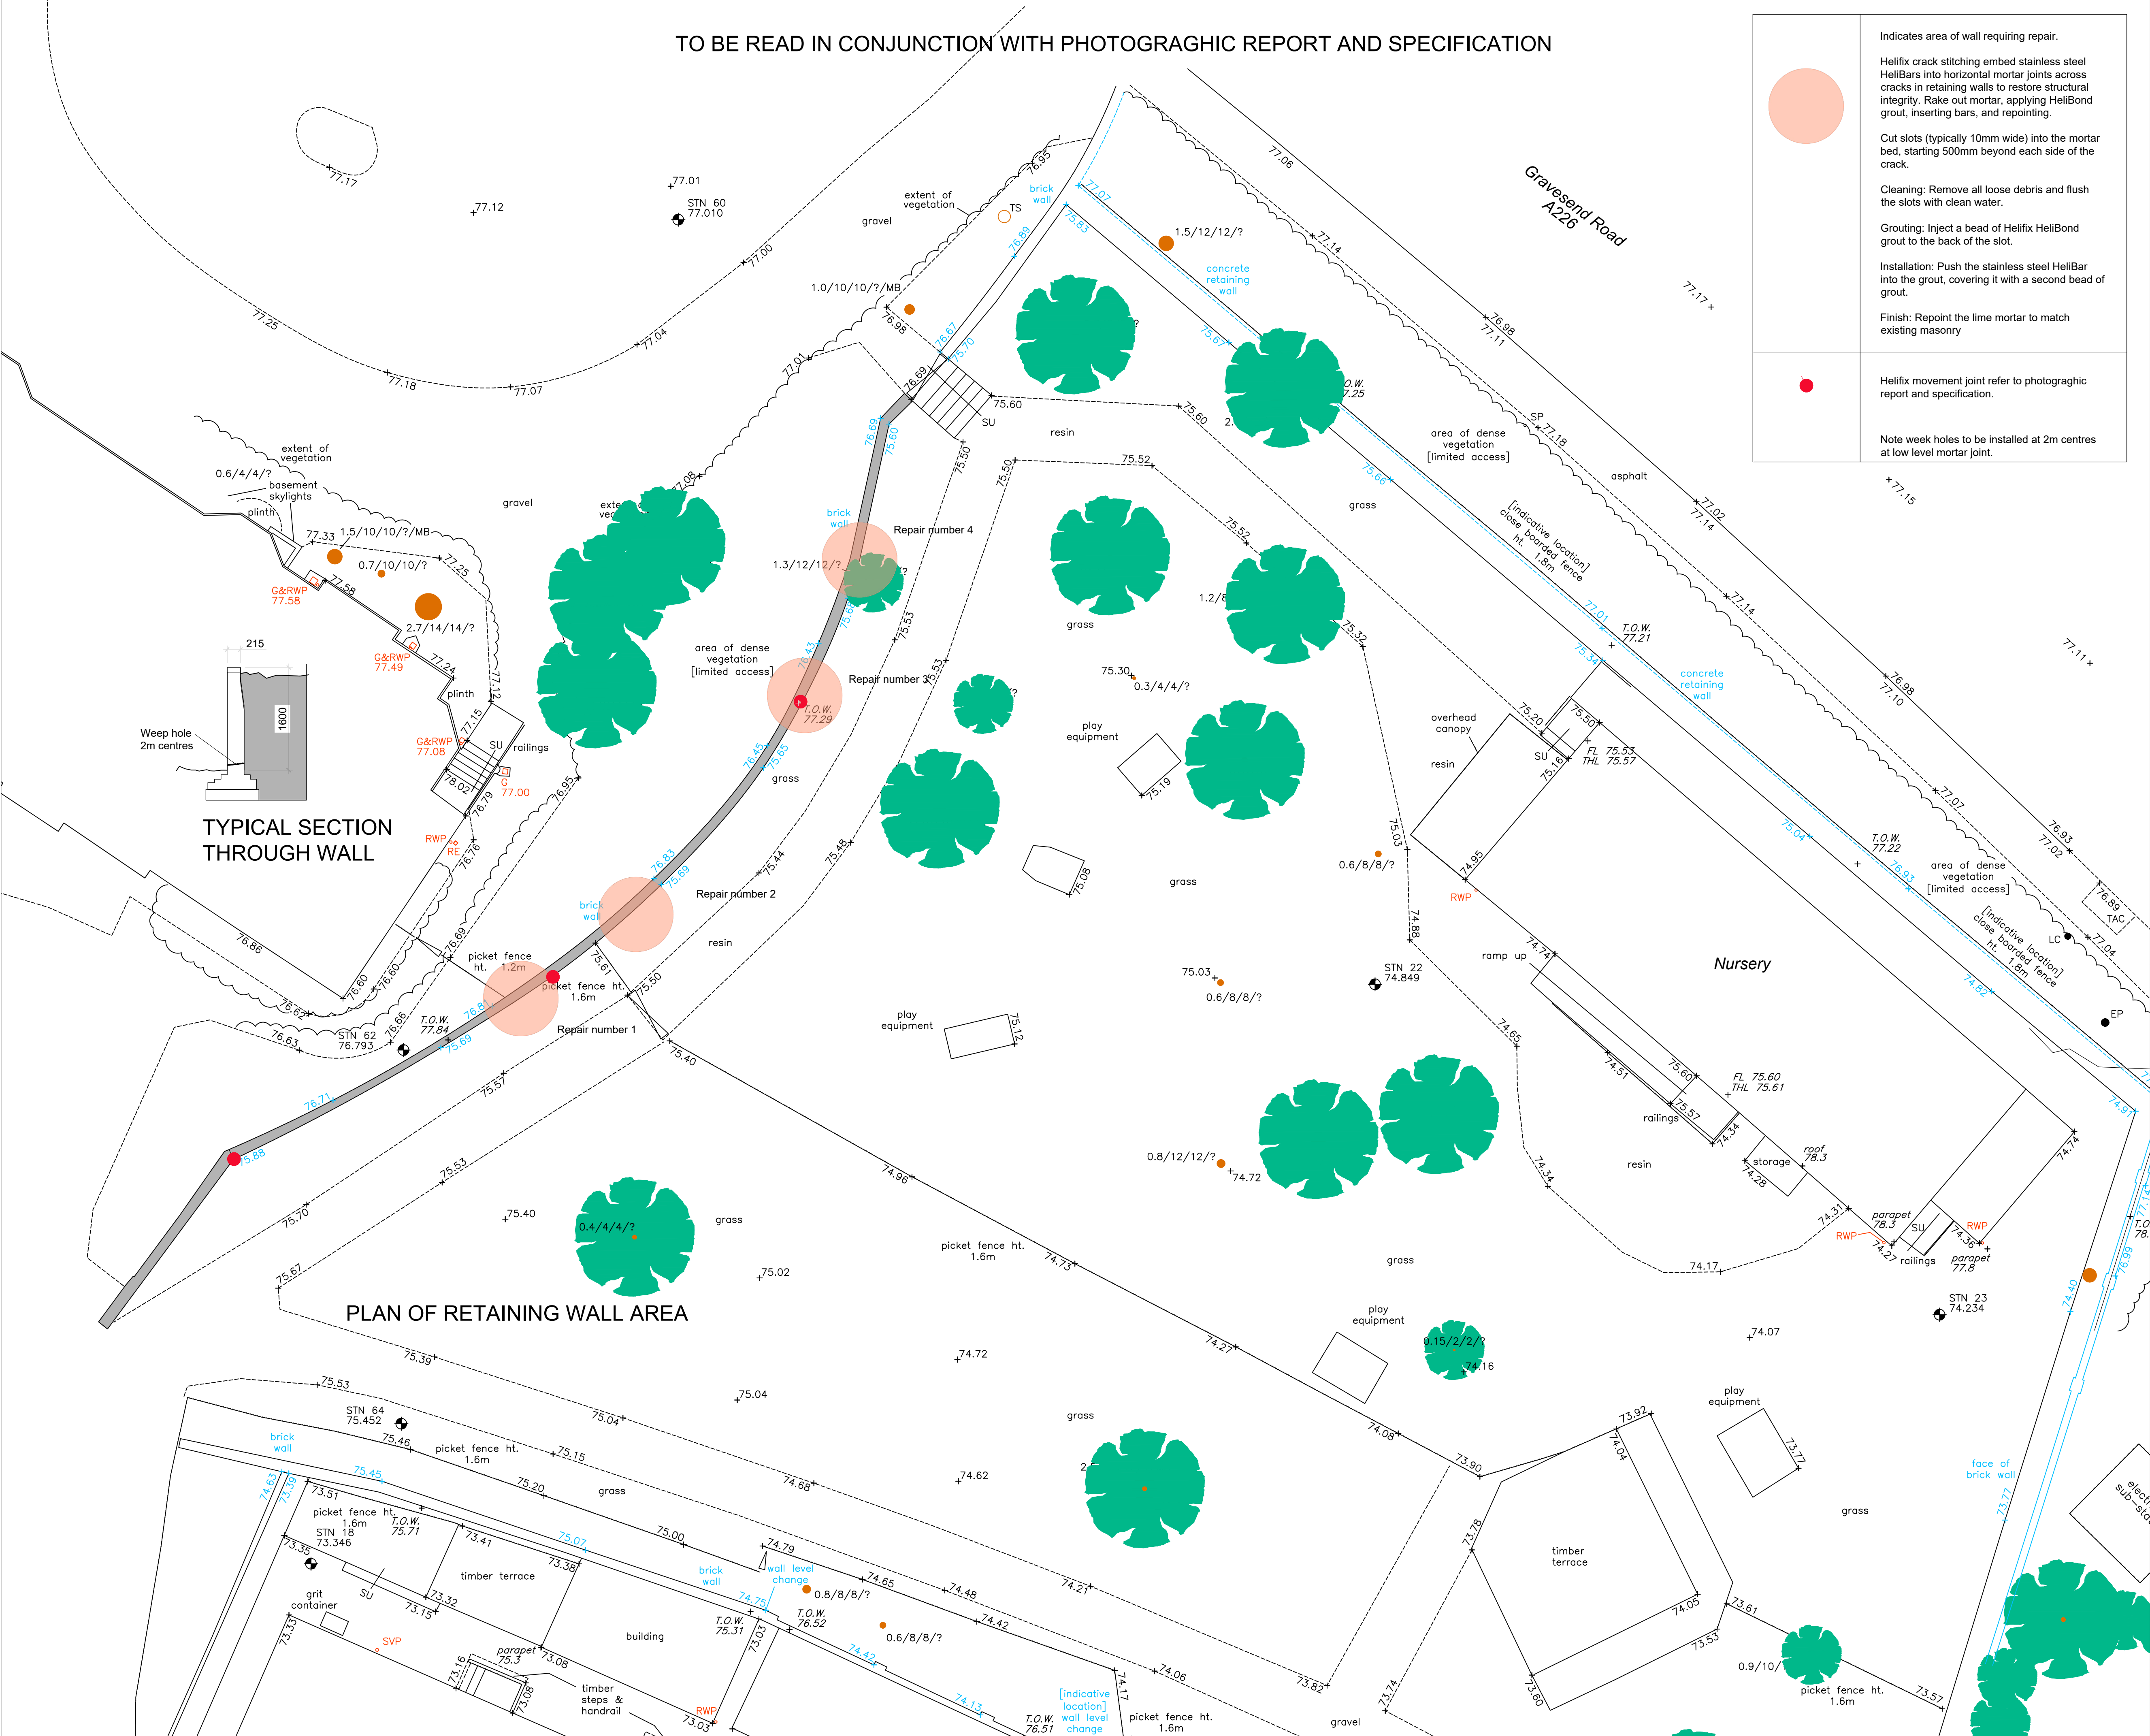

Indicates area of wall requiring repair.

Helifix crack stitching embed stainless steel Helibars into horizontal mortar joints across cracks in retaining walls to restore structural integrity. Rake out mortar, applying HeliBond grout, inserting bars, and repointing.

Cut slots (typically 10mm wide) into the mortar bed, starting 500mm beyond each side of the crack.

Cleaning: Remove all loose debris and flush the slots with clean water.

Grouting: Inject a bead of Helifix HeliBond grout to the back of the slot.

Installation: Push the stainless steel HeliBar into the grout, covering it with a second bead of grout.

Finish: Repoint the lime mortar to match existing masonry

Helifix movement joint refer to photographic report and specification.

Note week holes to be installed at 2m centres at low level mortar joint.

C

This drawing remains the Copyright of the architects and may not be reproduced in whole or in part without their written permission

NOTES

Do not scale

Verify all dimensions on site before commencing any work or preparing any shop drawings

All building materials, components and workmanship to comply with the appropriate Public Health Acts, Building Regulations, British & European Standards and Codes of Practice and to the appropriate manufacturers recommendations.

For all specialist work see relevant drawings

All schemes to be set out completely including buildings, roads, drainage and levels prior to the commencement of works

Sites to be checked against Land Registry plans and any necessary Easements to be established

Any discrepancies, errors or omissions to be reported to the architect for further instructions before commencement of works

K		
J		
H		
G		
F		
E		
D		
C		
B		
A		
Date	Revisions	By

DAC

Architects

21 Stone Street, Gravesend, Kent, DA11 0NP
 Tel: 01474 566996 Fax: 01474 320374
 Design@DACarchitects.co.uk

Project Title

Gads Hill School
Gads Hill Place
Gravesend Road. Higham.
Rochester. ME3 7PA

Client

Gads Hill School

Drawing Title

Low Level Retaining Wall
between Mansion and EYFS
Remedial and Repair
Measures

Scale	Date	Drawn By
1:100	17/03/26	LDM
Project No.	Dwg. No.	Rev.
5516	D-05	